


**Lands of Marin**  
**Job #: 09-1224**

**CORNER RECORD**

Document Number 188-150-74

Bolinas, County of Marin, California

Brief Legal Description: Being parcel A-2, of that certain map entitled "Parcel Map, Land of Division of Parcel A of Land Division of Lands of McDaniel", recorded in Book 6 of Parcel Maps at Page 51, Marin County Records

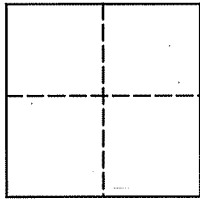

**CORNER TYPE**

Government Corner  Control   
Meander  Property   
Rancho  Other   
Date of Survey September 29, 2009

**COORDINATES (Optional)**

N \_\_\_\_\_  
E \_\_\_\_\_  
Zone \_\_\_\_\_ NAD27  NAD83   
NAD 83 Epoch \_\_\_\_\_  
Elev. \_\_\_\_\_  
Vert. Datum: NGVD29  NAVD88   
Meas. Units: Metric  Imperial

**Corner -** Left as found  Found and tagged  Established  Reestablished  Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:  
See Page 2 of 2

A description of the physical condition of the monument as found and as set or reset:  
See Page 2 of 2

**SURVEYOR'S STATEMENT**

This Corner Record was prepared by me or under my direction in conformance with  
The Land Surveyor's Act on October 5, 2009.

Signed [Signature] P.L.S. 6649



**COUNTY SURVEYOR'S STATEMENT**

This Corner Record was received OCTOBER 19, 2009  
and examined and filed NOVEMBER 16, 2009

Signed [Signature] P.L.S. or R.G.E. No. 7128

Title COUNTY SURVEYOR

County Surveyors' Comment \_\_\_\_\_



All distances shown are in feet and decimals thereof  
Easements not addressed

FOUND 2"X2" HUB & TAG,  
STAMPED "LS 2897" PER  
6 PM 57 AT SE'LY CORNER  
OF 4"X4" WOOD POST

**LEGEND**

- Set 60d Nail & Brass Washer,  
Stamped "LS 6649"
- ⊙ Set 3/4" Iron Pipe & Plastic Plug,  
Stamped "LS 6649"



(PCL. A-1, 6 PM 51)

CURVE TABLE		
CURVE	DELTA	LENGTH
C1	12°30'00"	33.82
C2	12°57'33"	29.40

**HORSESHOE HILL ROAD**

(N64°30'00"E 137.72)  
SHED  
S132.72  
S132.72  
CLEAR 2:1

R=155.00  
Δ=50°00'00"  
L=135.26

R=130.00  
Δ=51°50'00"  
L=117.67

BEARINGS  
592.67

4"X4" WOOD POSTS EXIST  
ALONG THIS LINE. APPEAR  
TO BE ON BOUNDARY LINE.

S04°13'12"E

(PCL. B, 2 PM 67)

**Lands of Marin**


(PCL. A-2, 6 PM 51)

FOUND NAIL IN CONCRETE  
ASSUMED TO BE STA 3-C  
AS SHOWN ON 6 PM 57

FOUND 2X2 HUB & TAG, "LS 2701" PER  
6 PM 57 REPLACED WITH 3/4" IRON PIPE  
AND PLASTIC PLUG, STAMPED "LS 6649"

FOUND 1/2" REBAR &  
TAG, STAMPED "LS 2897"  
PER 6 PM 57

**GRAPHIC SCALE**




NOT SURVEYED  
(N33°53'30"W 186.02')

WOOD PLANK FENCE  
ON BOUNDARY LINE

129.07'  
S70°39'00"W

ROOF OF  
PUMP SHED

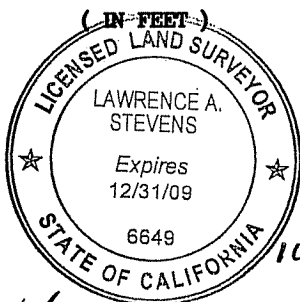

(N22°50'00"W)  
(33.70')

(S60°20'00"W 208.46')

**Plat of Survey  
Lands of Marin**

(PCL. A-2, 6 PM 51)

Holinas Marin County California  
Scale: 1" = 80' September 2009

**L.A. Stevens & Associates, Inc.**

Professional Land Surveyors \* (415) 382-7713  
7 Commercial Blvd., Suite 1 \* Novato, CA 94949

Lawrence A. Stevens, PLS 6649  
my license expires 12/31/09